### **Release Note for Vigor120 Series**

# Firmware Version: 3.2.4.4 Built Date: September 06, 2010 Applied Models: Vigor120

- File and Modem Code
  - (1)For Annex A Model,
    - > "v120\_a\_v3244" is used for modem code 321311. (Standard)
    - > "v120\_a1\_v3244" is used for modem code 310801.
    - > "v120\_a2\_v3244" is used for modem code 310811.
    - > "v120\_a3\_v3244" is used for modem code 3211201
    - > "v120\_a4\_v3244" is used for modem code 332201.
    - > "v120\_a5\_v3244" is used for modem code 343601.
    - > "v120\_a6\_v3244" is used for modem code 343701 (recommended for Italy).
    - > "v120\_a7\_v3244" is used for modem code 3431301.
    - ➤ "v120\_a8\_v3244" is used for modem code 344001.
    - ➤ "v120\_a9\_v3244" is used for modem code 344101.

#### **New Features**

Be able to change TR-069 CPE Client username and password.

#### **Improvement**

- Corrected: Vigor router acts as a DHCP client and sends the DHCP packets with the same DHCP transaction ID to DHCP server.
- Corrected: Save problem occurs for Interval Time of Periodic Inform Settings in System Maintenance>>TR-069.
- Corrected: TR-069 service doesn't work when ACS Server URL sets HTTPS URL without port number configured.
- Corrected: May meet reboot problem when type "ip igmp\_proxy status" command.
- Corrected: 1483 routed mode can not work on PVC WAN3/4/5.
- Corrected: Crash occurred when TR-069 session is timeout.

- Corrected: ADSL TX throughput can not exceed 1Mbps while ADSL link is on Annex M mode.
- Improved: ADSL link problem.
- Improved: Let HTTP Host header to use domain or IP address according to ACS URL setting.

## **Known Issue**

None

## **Notes**

#### **Modifications**

None