

Release Note for Vigor2700 Series

Firmware Version: 2.8.3

Built Date: July 06, 2009

Applied Models:

**Vigor2700, Vigor2700G, Vigor2700V(2S/2S1L), Vigor2700VG(2S/2S1L),
Vigor2700Gi (Annex B), Vigor2700VGi (Annex B)**

- File and Modem Code

(1)For Annex A Model,

- "v2k7v_a_283.xxx" is used for modem code 121201. (Standard)
- "v2k7v_a1_283.xxx" is used for modem code 113111.
- "v2k7v_a2_283.xxx" is used for modem code 131701. (Recommended for UK-SEG)
- "v2k7v_a3_2832.xxx" is used for modem code 1401201. (Recommended for USA or for G.lite environment)
- "v2k7v_a4_283.xxx" is used for modem code 1411301.
- "v2k7v_a5_283.xxx" is used for modem code 142201.

(2)For Annex B Model,

- "v2k7v_b_283.xxx" is used for modem code 131812. (Standard)
- "v2k7v_b1_283.xxx" is used for modem code 113112.
- "v2k7v_b2_283.xxx" is used for modem code 1211202.
- "v2k7v_b3_283.xxx" is used for modem code 1311302. (Recommended for Germany)
- "v2k7v_b4_283.xxx" is used for modem code 1401302.
- "v2k7v_b5_283.xxx" is used for modem code 1411402.
- "v2k7v_b6_283.xxx" is used for modem code 142112. (Support T1.413 Annex B, recommended for Spain)
- "v2k7v_b7_283.xxx" is used for modem code 142402.

New Features

- Add a new telnet command "adsl showbins up" to show bits of bin on upstream.
- Add DSL default settings for Portugal.
- Support TFTP ALG.
- Add MTU size item on Web Interface.
- Add "Select all" button in DOS Web Interface.

Improvement

- Corrected: IGMP Snoop (on Web Interface) can't be saved.
- Corrected: Modify ADSL modulation word from "T.1413" to "T1.413" on Web Interface.
- Corrected: Wireless connection failed while security set.
- Corrected: The router will reboot if 64 WPA clients connect to AP at the same time.
- Corrected: Wireless halt problem occurred if encryption client numbers exceed 62.
- Corrected: Display error in Trace Route Web Interface.
- Corrected: Packet fragmentation function error in the True IP DMZ application.
- Corrected: Daylight saving wrong in some time zone.
- Corrected: VPN (LAN to LAN) stop to dial out when connection failed and status stay in IF_LINKING.
- Corrected: VPN dial out failed and the status stay in IF_ASSIGNED for a long time.
- Corrected: Sipalg QoS class 1 and 2 default configuration setting error issue.
- Limit maximum PPP MSS to 1438 for Vietnam.
- Change the words from "Start IP Address" to "Assigned IP range".
- Modify the description for Corrected blocks and Uncorrected blocks in Online Status Web Interface.

Known Issue

- None

Notes

Modifications

- None