

Release Note for Vigor2710 Series

Firmware Version: 3.6.3.1

Built Date: January 17, 2013

Applied Models:

Vigor2710, Vigor2710n, Vigor2710Vn, Vigor2710VDn

- File and Modem Code

(1)For Annex A Model,

- " v2710_a_3631" is used for modem code 211011. (Standard)
- " v2710_a1_3631" is used for modem code 211801.
- " v2710_a2_3631" is used for modem code 2121501.
- " v2710_a3_3631" is used for modem code 2211201.
- " v2710_a4_3631" is used for modem code 232201. (Recommended for UK – SEG)
- " v2710_a5_3631" is used for modem code 243601.
- " v2710_a6_3631" is used for modem code 243701.
- " v2710_a8_3631" is used for modem code 244001.
- " v2710_a7_3631" is used for modem code 2431301.
- " v2710_a9_3631" is used for modem code 2471201.

(2)For Annex B Model,

- " v2710_b_3631" is used for modem code 2111112. (Standard)
- " v2710_b1_3631" is used for modem code 2111302. (Recommended for Attel Czech only)
- " v2710_b2_3631" is used for modem code 2121302 (recommended for Slovskia only).
- " v2710_b4_3631" is used for modem code 214702.
- " v2710_b5_3631" is used for modem code 2111312.
- " v2710_b6_3631" is used for modem code 215202.
- " v2710_b7_3631" is used for modem code 246302.

New Features

- Support ACS Notification function.
- Support Wireless Wizard.
- Support 3G Backup for UK.

Improvement

- Corrected: NAT loopback did not work for wireless clients.
- Corrected: DHCP Table showed wrong Leased Time.
- Corrected: Yahoo email was blocked by the item of **Wujie/UltraSurf** in the **Misc** tab of **CSM>>APP Enforcement Profile**.
- Corrected: IPv6 traffic via AICCU causes router system reboot.
- Corrected: When a user performed Port Scan with AICCU IPv6 LAN IP, the router system reboot would occur.
- Corrected: Fixed the router system reboot caused by VPN remote dial-in user.
- Corrected: L2TP over IPSec with Windows 7 did not work correctly.
- Corrected: Trace Route did not work for 3G mode.
- Improved: Add inter-digit timeout setting on WUI and TR-104.
- Improved: Support editing DHCP Options (ASCII/Hex) on web user interface.
- Improved: Support fax via "fax transmission 1 bypass g711 alaw64k".
- Improved: Modify the wording from "TSPC Status" to "IPv6 TSPC Status".
- Improved: Support the DNS 8.8.8.8 for WCF function for authentication.
- Improved: Allow to use "-" and "." in admin password via WUI.
- Improved: PPTP log in possible with "???" and no password with activated LAN-LAN Profile.
- Improved: Add "annex M" in ADSL auto mode for Denmark.
- Improved: Add a telnet command to set ADSL auto mode modulation.
adsl automode [add/remove/set/default/show] [adsl_mode]
- Improved: APPE support RC_voice, teamviewer, ppstream.
RC Voice version: 7.0
teamviewer 8.0.16284, 7.0.15723
PPStream 2.7.0.1512

Known Issue

- None

Notes

Modifications

- None