Release Note for Vigor2710 Series

Firmware Version: 3.6.3.2 Release Date: April 26, 2013 Applied Models:

Vigor2710, Vigor2710n, Vigor2710Vn, Vigor2710VDn

• File and Modem Code

(1)For Annex A Model,

- \succ "v2710_a_3632" is used for modem code 211011. (Standard)
- v2710_a1_3632" is used for modem code 211801.
- > " v2710_a2_3632" is used for modem code 2121501.
- ➤ " v2710_a3_3632" is used for modem code 2211201.
- ▶ "v2710_a4_3632" is used for modem code 232201. (Recommended for UK SEG)
- ➤ " v2710_a5_3632" is used for modem code 243601.
- ➤ " v2710_a6_3632" is used for modem code 243701.
- ➤ " v2710_a8_3632" is used for modem code 244001.
- > "v2710_a7_3632" is used for modem code 2431301.
- ➤ " v2710_a9_3632" is used for modem code 2471201.

(2)For Annex B Model,

- ➤ " v2710_b_3632" is used for modem code 2111112. (Standard)
- "v2710_b1_3632" is used for modem code 2111302. (Recommended for Attel Czech only)
- v2710_b2_3632" is used for modem code 2121302 (recommended for Slovskia only).
- ➤ " v2710_b4_3632" is used for modem code 214702.
- ➤ " v2710_b5_3632" is used for modem code 2111312.
- ➤ " v2710_b6_3632" is used for modem code 215202.
- ➤ " v2710_b7_3632" is used for modem code 246302.

New Features

- Support IPv6 printer service.
- Support "vigorddns" service.
- Support IPv6 NTP service

Improvement

- Improved: PPTP log in possible with "???" and no password with activated LAN-LAN Profile.
- Improved: SIP "via" information will not be modified by SIP ALG.
- Improved: Support blocking RaidCall (v7.0) and PPStream (v2.7.0.1512).
- Improved: Support the feature of H.323_alg passthrough.
- Improved: Support an option of All for WAN Interface in NAT >> Open Ports.
- Improved: Modify the NTP domain name resolving period from once every 20 seconds to 10 seconds prior to the time specified by Automatically Update Interval.
- Improved: SNMP client is unable to connect to the router on 2nd subnet.
- Improved: The router accepts asterisk (*) as the administrator password.
- Improved: When the user accesses into a website that two categories detected by Commtouch, the router can only show/handle one category.
- Improved: Changed the default setting from "Both: Pass" to "Either: URL Access Control First" for URL content filter.
- Corrected: Overwrite problem might occur when many PPTP dial in/out connections established at the same time.
- Corrected: If MPPE is selected, the PPTP remote dial-in user (client) may not connect to the router.
- Corrected: PPTP VPN connection might not be established under the IPsec LAN-to-LAN tunnel of Vigor router.
- Corrected: Remote dial-in user can not create another PPTP tunnel to another PPTP server.
- Corrected: Unable re-dial out LAN to LAN VPN tunnel after VPN tunnel is down and VPN server is available again.
- Improved: A PC gets IP address from the DHCP server of the router, but the secondary DNS server on PC will be the same as the primary DNS server.
- Corrected: Daylight Saving didn't work with time zone Adelaide (GMT +9:30).
- Corrected: Two IP phones behind NAT were unable to call each other after a period of time.

Known Issue

• None

Notes

Modifications

• None